

Stock No.569


■ Dimensional drawing Unit : mm

Graduated precision square (type - C)

Traceability can be issued.

- Grade-1 squares with a stand. They are graduated in millimeters.
- All models are without hardened.
- *Only one side of the squares is graduated.

$$\text{formula } \pm \left(10 + \frac{\ell}{20} \right) \mu\text{m} \quad \ell = \text{Size}$$

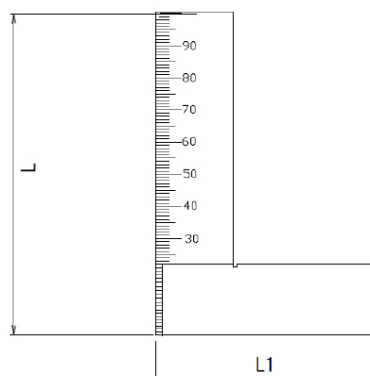

Size	L	L1
100	100	70
150	150	100
200	200	130
250	250	165
300	300	200
400	400	200
600	600	300
1000	1000	550

Material : SS
Package : Wooden box

Configuration of stock number

569 0100 C
 |
 Size

Product No	Stock No	Size (mm)	Tolerance for deviation from right angles ($\pm\mu\text{m}$)	Weight (kg)
31-0100	569-0100C	100	15.0	0.18
31-0150	569-0150C	150	17.5	0.4
31-0200	569-0200C	200	20.0	0.74
31-0250	569-0250C	250	22.5	1.0
31-0300	569-0300C	300	25.0	1.7
31-0400	569-0400C	400	30.0	2.5
31-0600	569-0600C	600	40.0	6.7
31-1000	569-1000C	1000	60.0	29.6


Stock No.570

Graduated precision square (type - E)

Traceability can be issued.

- Grade-1 flat-type squares graduated in millimeters.
- All models are without hardened.
- *Only one side of the squares is graduated.

$$\text{formula } \pm \left(10 + \frac{\ell}{20} \right) \mu\text{m} \quad \ell = \text{Size}$$

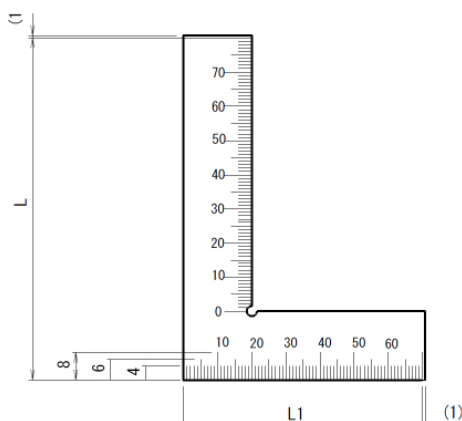

Size	L	L1
100	100	70
150	150	100
200	200	130
250	250	165
300	300	200
400	400	200
500	500	300
600	600	300
750	750	450
1000	1000	550

Material : S50C
Package : Paperboard Box(100 ~ 400)
Wooden Box(500 ~ 1000)

Configuration of stock number

570 0100 E
 |
 Size

Product No	Stock No	Size (mm)	Tolerance for deviation from right angles ($\pm\mu\text{m}$)	Weight (kg)
32-0100	570-0100E	100	15.0	0.08
32-0150	570-0150E	150	17.5	0.22
32-0200	570-0200E	200	20.0	0.35
32-0250	570-0250E	250	22.5	0.54
32-0300	570-0300E	300	25.0	0.66
32-0400	570-0400E	400	30.0	1.4
32-0500	570-0500E	500	35.0	1.91
32-0600	570-0600E	600	40.0	3.3
32-0750	570-0750E	750	47.5	4.3
32-1000	570-1000E	1000	60.0	8.4