
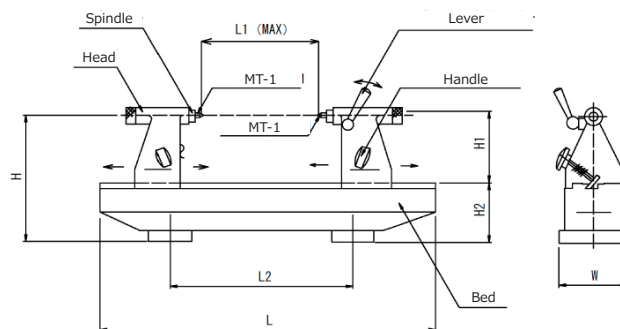


Stock No.563

Bench center (type-P)

Traceability can be issued.

- This compact runout tester can be used on a surface plate or workbench.
- A dedicated stand is included with each unit. However, the dial indicator and test bar are not included.
- Custom sizes are available to accommodate different workpiece lengths and diameters.

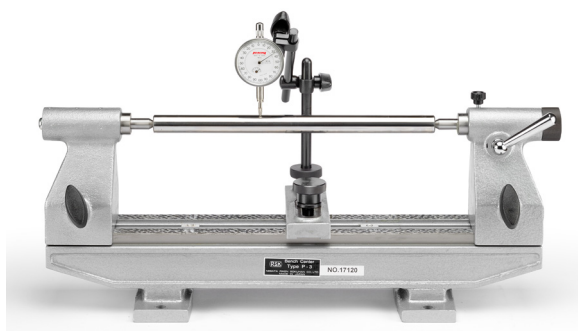

Material : Cast iron (Bed, Head)
Package : Reinforced cardboard
Accessories: Certificate of inspection


Configuration of stock number

563 P1L
 |
 P1L → P-1
 P2L → P-2
 P3L → P-3


Product No	Stock No	Model	L (mm)	W (mm)	H2 (mm)	L1 (mm)	H1 (mm)	Parallelism between center (μm)	Applicable center	Weight (kg)
55-2-1	563-P1L	P-1	380	120	65	150	110	5.0	MT-1	14
55-2-2	563-P2L	P-2	430	120	72	200	110	5.0	MT-1	16
55-2-3	563-P3L	P-3	530	130	90	300	110	5.0	MT-1	20

About Dial Stand

Both the Standard Type and P Type come with one dedicated dial indicator stand. (The stand for the P Type is shown on the left.) Depending on the inspection requirements, using multiple dial indicator stands allows for faster and more reliable measurements. We also manufacture dedicated stands and mounting brackets for dial test indicators. (See the figure on the right.)

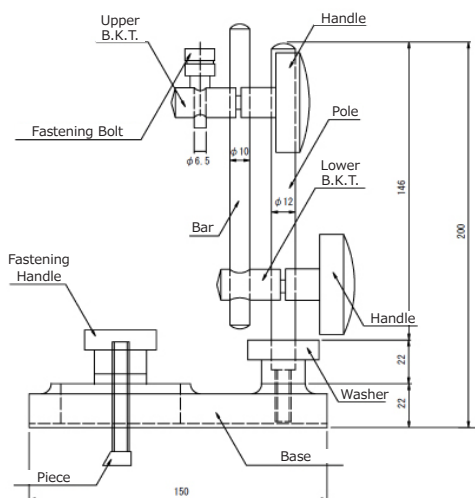

Dial stand for P

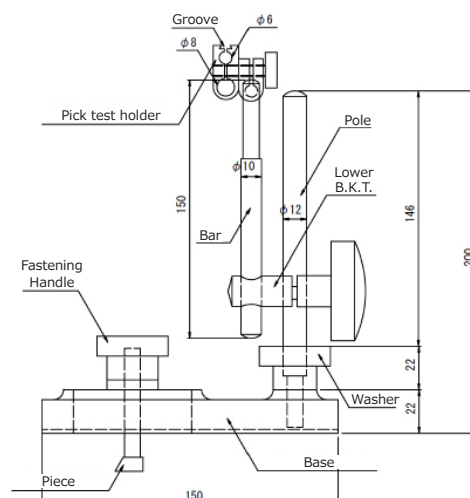

Dial stand for P-type pick testing